

# **Pinellas Environmental Restoration Project**

Semiannual Progress Report for the Young - Rainey STAR Center's 4.5 Acre Site December 2007 through May 2008

June 2008



# Office of Legacy Management

## Pinellas Environmental Restoration Project Semiannual Progress Report for the Young – Rainey STAR Center's 4.5 Acre Site

December 2007 Through May 2008

June 2008

### **Contents**

Acron	yms and Abbreviations	iv
1.0	Introduction	1
	1.1 Site Activities	
2.0	Monitoring Data	
	2.1 Groundwater Elevations and Flow	
	2.2 Groundwater Sampling	
	2.3 Groundwater Analytical Results	
	2.4 Quality Assurance/Quality Control	
	Data Interpretation	
	3.1 Contaminant Concentration Trends	
	3.2 Plume Maps	
	3.3 Geochemical Parameters	
	Γasks to Be Performed Semiannually	
5.0	References	6
	77.	
	Figures	
E:	1 Vanna Dainara CTAD Cantan Lagration	7
Figure		
Figure		8
Figure		0
Figure	February 2008	9
riguie	February 2008	10
Figure		
	10. TCE, cDCE, and VC in PIN20–M060	
	11. TCE, cDCE, and VC in PIN20–M061	
	12. 4.5 Acre Site Trichloroethene Concentrations March 2008 Sampling Event	
	13. 4.5 Acre Site cis-1,2-Dichloroethene Concentrations March 2008 Sampling Even	
	14. 4.5 Acre Site Vinyl Chloride Concentrations March 2008 Sampling Event	
	15. 4.5 Acre Site Benzene Concentrations March 2008 Sampling Event	
1 18410	To the file of the Benzene Concentrations whiten 2000 sampling Byon	= 1
	Tables	
	1 unics	
	1. Water-Level Data at the 4.5 Acre Site	
	2. 4.5 Acre Site Surface Water Elevations.	
	3. Field Measurements of Samples Collected at the 4.5 Acre Site	
	4. COPC Concentrations from Wells at the 4.5 Acre Site	
Table	5. RPD for Duplicate Samples, 4.5 Acre Site	28

		Appendix
Appendix A	Laboratory Reports-	-February-March 2008 Annual Results

### **Acronyms and Abbreviations**

bls below land surface cDCE cis-1,2-dichlororethene

COPC contaminants of potential concern

CTL cleanup target level

DOE U.S. Department of Energy DPE dual-phase extraction

EPA U.S. Environmental Protection Agency

F.A.C. Florida Administrative Code

FDEP Florida Department of Environmental Protection

ft feet

IRA Interim Remedial Action
μg/L micrograms per liter
μmhos/cm micromhos per centimeter
MCL maximum contaminant level

mg/L milligrams per liter

mV millivolts

NGVD national geodetic vertical datum
NTU Nephelometric Turbidity Units
QA/QC quality assurance/quality control
RBCA Risk-Based Corrective Action
RPD relative percent difference

STAR Center Young - Rainey Science, Technology, and Research Center

TCE trichloroethene

TCOPC total contaminants of potential concern

VC vinyl chloride

VOCs volatile organic compounds

### 1.0 Introduction

The *Pinellas Environmental Restoration Project Semiannual Progress Report 4.5 Acre Site* describes environmental restoration activities for the Pinellas 4.5 Acre Site located in Pinellas County, Largo, Florida (Figure 1). The former U.S. Department of Energy (DOE) Pinellas Plant facility consisted of the 4.5 Acre Site and the Young - Rainey Science, Technology, and Research Center (STAR Center) (Figure 2). The facility was constructed in the mid-1950s as part of a nationwide nuclear weapons research, development, and production complex. Production of weapons-related components ceased in September 1994. However, as a result of these operations, contamination exists in the surficial groundwater beneath the site.

Administration of DOE activities at the 4.5 Acre Site is the responsibility of the DOE Office of Legacy Management in Grand Junction, Colorado. S.M. Stoller Corporation (Stoller), a prime contractor to DOE's Office of Legacy Management, provides technical support to DOE for the remediation and closure of all active solid-waste management units on site and for the 4.5 Acre Site.

The 4.5 Acre Site is located to the northwest of the STAR Center, in the northeast quarter of Section 13, Township 30 South, Range 15 East (Figure 1). DOE owned this parcel from 1957 to 1972, at which time it was sold to a private landowner. During the period of DOE ownership, the property was used for disposal of drums of waste resins and solvents. As a result of this practice, the surficial aquifer was impacted by volatile organic compounds (VOCs), primarily vinyl chloride (VC), toluene, trichloroethene (TCE), and 1,2-dichloroethene (DCE). DOE completed a source removal in 1985.

An Interim Remedial Action (IRA) consisting of groundwater extraction and treatment via air stripping, and a routine groundwater monitoring program were initiated in May 1990. In July 1997, a modification of the IRA, involving the installation of dual-phase extraction (DPE) wells, provided a more aggressive system to remove groundwater contamination. In November 1999, the DPE/air-stripping system was replaced with an in-situ biosparge treatment system.

The 4.5 Acre Site Biosparge System Integration Plan (DOE 2000) was approved by the Florida Department of Environmental Protection (FDEP) on January 17, 2001. This plan states that performance monitoring would be undertaken on a quarterly basis. Therefore, in April 2001, performance monitoring of the remedial system through the use of direct push technology was undertaken. However, the biosparge systems were shut off in May 2003 with no plans to restart them and no performance monitoring data have been collected since April 2003. Subsequent monitoring was then adapted to fit the new remediation scenario and performance monitoring as defined in the Interim Remedial Action Plan for Ground Water Recovery at the 4.5 Acre Site (DOE 2003b).

The IRA Plan for Ground Water Recovery at the 4.5 Acre Site was submitted to FDEP on August 29, 2003, and approved by FDEP on September 19, 2003. Implementation of the IRA Plan commenced on March 8, 2004, when construction activities began on the IRA treatment system. The treatment system consisted of an extraction well field (three recovery wells), pumps and associated piping, a transmission water pipeline, a utility connection, a low profile tray air stripper unit, and effluent piping. The new IRA system began operations on April 26, 2004.

The IRA system was a temporary measure that was outlined in the *Remedial Action Plan for the Pinellas 4.5 Acre Site* (DOE 2001) as a contingency option in the event that biosparging resulted in extending the contaminant plume. In April 2005, the *Pinellas Environmental Restoration Project 4.5 Acre Site Remedial Action Plan Addendum* (DOE 2005) was submitted to FDEP. This document presented a proposed final action for the 4.5 Acre Site that involves the closure of the site using the provisions of the recently adopted State of Florida Global Risk-Based Corrective Action (RBCA) regulations.

Technical discussions between FDEP and DOE regarding the proposed final action continue. Part of DOE's proposed final action for the 4.5 Acre Site was to shut down the IRA system and begin a 2-year monitoring period. Approval from FDEP to shut down the IRA system was received on December 20, 2005, thus commencing the DOE's 2-year monitoring period.

Although DOE has conducted numerous remediation activities at the 4.5 Acre Site since 1985, FDEP has recently suggested that, based on elevated levels of VOCs in groundwater, a source of VOCs may remain in the subsurface, and that removal of contaminated soil may be necessary (FDEP 2005). To investigate this concern, 1,172 soil samples were collected from 138 soil borings installed at two areas of the site during the summer of 2007. Analytical results demonstrated that the following contaminants were present in site sediments at concentrations that likely represent a source of contamination to groundwater: TCE; cis-1,2-DCE (cDCE); trans-1,2-DCE (tDCE); and toluene. Results from this characterization effort can be found in the 4.5 Acre Site Source Characterization Data Report (DOE 2007).

In April 2008, DOE presented a feasibility study that evaluated the available contaminant source removal technologies. The preferred option for source removal at the 4.5 Acre Site was determined to be soil excavation using a large-diameter auger and off-site disposal of soil (DOE 2008). In a letter dated May 17, 2008, the FDEP states "the report is acceptable for its intended purpose" and "the preferred option for source removal of soil excavation using large diameter auger and off-site soil disposal is also acceptable to the Department". Large-diameter auger remedial action activities are anticipated to commence in early November 2008 and be completed by June 2009.

This document is the semiannual progress report for the 4.5 Acre Site for December 2007 through May 2008, as requested by FDEP. The results of monitoring activities and a summary of ongoing and projected work are provided in this report.

### 1.1 Site Activities

- Obtained water-level measurements from all monitoring wells on February 26, 2008.
- Conducted the annual sampling event (i.e., collected groundwater samples from 40 monitoring wells in February and March 2008). Forty wells were sampled for VOCs and analyzed using U.S. Environmental Protection Agency (EPA) SW-846 Method 8260.
- Reported the results of the annual sampling event (this document).

### 2.0 Monitoring Data

### 2.1 Groundwater Elevations and Flow

On February 26, 2008, depth-to-water measurements were taken in all monitoring wells and former recovery wells at the 4.5 Acre Site. The depth to water in each well was measured with an electronic water-level indicator. The groundwater elevation data are listed in Table 1. Surface water elevations for Pond 5 (southeast of the 4.5 Acre Site), the West Pond (to the east), and the pond immediately north of the 4.5 Acre Site are listed in Table 2. The water elevation data were used to construct contours of water levels in the shallow and deep portions of the surficial aquifer (Figure 3 and Figure 4). Groundwater in the shallow surficial aquifer generally flows to the west, and groundwater in the deep surficial aquifer flows to the west-northwest.

The average hydraulic gradient across the site was approximately 0.0027 feet per foot (ft) in February 2008. This gradient is similar to that observed the previous year at the site. Calculations using Darcy's Law along with approximations of 1 ft/day for hydraulic conductivity and 0.3 for effective porosity indicate that groundwater at the site is estimated to move about 3 ft/year. This velocity is on the low end of previously observed velocities of 2 to 10 ft/year.

### 2.2 Groundwater Sampling

Groundwater samples were collected from 40 monitoring wells at the 4.5 Acre Site in February and March 2008. Samples from all 40 wells were analyzed for VOCs.

All samples were collected in accordance with the Stoller Sampling Procedures for the Young - Rainey STAR Center and 4.5 Acre Site (DOE 2006), using FDEP procedures. All samples were submitted to TestAmerica, Tampa, Florida for analysis. TestAmerica in Tampa, Florida, is accredited by the Florida Department of Health in accordance with the National Environmental Laboratory Accreditation Conference, certification number E84282. VOCs were analyzed using EPA method SW-846 8260B. All monitoring wells were micropurged using a dedicated bladder pump, and sampling was performed when the field measurements stabilized. Table 3 lists field measurements of pH, specific conductance, dissolved oxygen, oxidation-reduction potential, turbidity, and temperature recorded at the time the samples were collected. Measurements were made with a flow cell and a multiparameter instrument.

### 2.3 Groundwater Analytical Results

Table 4 presents individual contaminants of potential concern (COPC) and total COPCs (TCOPCs) concentrations in samples collected from wells at the 4.5 Acre Site. The previous two semiannual results are included in Table 4 for comparison. Figure 5 shows the TCOPCs concentrations for March 2008.

The maximum TCOPCs value detected in February and March was 3,568 micrograms per liter ( $\mu$ g/L) at PIN20–M001. The compound detected at the highest concentration in PIN20–M001 was VC at a concentration of 2,900  $\mu$ g/L.

Laboratory reports for semiannual samples collected in February and March 2008 are provided in Appendix A.

### 2.4 Quality Assurance/Quality Control

The results from the analytical laboratory, TestAmerica, were checked for quality assurance/quality control (QA/QC) through duplicate samples and trip blanks. Detected analytes for each duplicate sample collected from the 4.5 Acre Site are listed in Table 5. The duplicate sample results were compared and the relative percent differences (RPDs) between the results were calculated. The duplicate results did not meet the EPA recommended laboratory duplicate criteria of less than 20 percent RPD for results that are greater than 5 times the practical quantitation limit for tDCE and VC. There were no analytical errors identified that would account for the poor precision. All other data passed QA/QC criteria at a Class A level, indicating that the data may be used for quantitative and qualitative purposes.

As specified in *Sampling Procedures for the Young - Rainey STAR Center and 4.5 Acre Site* (DOE 2006), duplicate samples should be collected at a frequency of one duplicate for every 20 or fewer samples. For the STAR Center and the 4.5 Acre Site, there were 143 groundwater samples collected, with 7 duplicate samples collected. The duplicate requirements for this sampling event were met. There were 11 trip blanks collected during this event. All trip blank results were negative.

A data validation software module for identifying and tracking anomalous groundwater data points within the SeePRO database was used to generate a report of analytical results that fall outside of historical minimum or maximum values. No anomalous results were identified.

### 3.0 Data Interpretation

This data interpretation section is included to aid in evaluating plume stability. This section consists of plots showing contaminant concentration trends (Section 3.1), plume maps (Section 3.2), and a discussion of site geochemistry (Section 3.3).

While most of the previous documents for the 4.5 Acre Site have compared groundwater contaminant concentrations to drinking water standards (i.e., maximum contaminant levels [MCLs]), those standards are not the applicable default Cleanup Target Levels (CTLs) for the purposes of evaluating site remediation under RBCA. Based on a comprehensive review of background data for the site (DOE 2003a), it was determined that the shallow groundwater in the site vicinity is naturally elevated in aluminum and iron at levels far exceeding State of Florida Secondary Drinking Water Standards (Chapter 62-550, Florida Administrative Code [F.A.C.]). Specifically, the average background concentration of 1.1 milligrams/liter (mg/L) for aluminum exceeds the 0.2 mg/L secondary standard, and the average background concentration for iron of 9.3 mg/L exceeds the 0.3 mg/L secondary standard. The ambient shallow groundwater in the area is, therefore, designated as "poor quality" as defined in 62-780.200 (35), F.A.C. Thus, the applicable groundwater CTLs are those for groundwater of "low yield/poor quality" provided in Table 1 of Chapter 62-777, F.A.C. In essence, these CTL values are a factor of 10 higher than the MCL values.

### 3.1 Contaminant Concentration Trends

Figure 6 and Figure 7 show the cDCE and VC concentration trends in wells PIN20–0502 and –M001, respectively. These two wells, located hydraulically downgradient from the area of highest contaminant concentrations, have shown increasing concentration trends over the last few years. This appears to be a result of past operation of the biosparging system, as described in previous reports. However, it appears that the contaminant concentrations in both wells are now decreasing.

Figure 8 and Figure 9 show TCE, cDCE, and VC concentration trends in wells PIN20–MWL4 and –M063. These two wells are in the area of highest contaminant concentrations on the eastern side of the site. Concentrations in these wells have shown an overall decreasing trend. The contaminant concentrations in well M063 decreased significantly since March 2007. This change may be due to a change in the local hydrology caused by numerous soil borings installed during the summer of 2007.

Figure 10 and Figure 11 show TCE, cDCE, and VC concentration trends in wells PIN20–M060 and –M061. These wells are in the area of elevated contaminant concentrations near the southwest property boundary. The contaminant concentrations in these wells do not show distinct trends, with both wells exhibiting significant increases and decreases over time.

### 3.2 Plume Maps

Plume maps were generated for TCOPCs (Figure 5) and the individual site COPCs: TCE (Figure 12), cDCE (Figure 13), VC (Figure 14), and benzene (Figure 15). The inferred plume boundaries for the individual compounds are the respective CTLs of the compounds. Concentrations that are below the CTL are not included in the individual compound plumes. The TCOPCs map is a summary of the individual compound maps. The plume maps also show the plume boundary from the previous year to show any changes over the last year.

In summary, the 2008 contaminant plume at the 4.5 Acre Site is similar in size to the 2007 plume. No COPCs were detected above the CTL in off-site wells. The plume appears stable in terms of area.

### 3.3 Geochemical Parameters

Geochemical parameters measured in the field in all wells at the 4.5 Acre Site during February and March 2008 are summarized in Table 3. Conditions across the site generally are reducing as evidenced by the low values of dissolved oxygen and oxygen reduction potential.

### 4.0 Tasks to Be Performed Semiannually

The following tasks are scheduled during the next semiannual period (June through November 2008).

- Semiannual sampling and analysis of groundwater in September 2008.
- Collect water-level measurements in September 2008.

### 5.0 References

- DOE (U.S. Department of Energy), 2000. 4.5 Acre Site Biosparge System Integration Plan, GJO–2000–182–TAR, MAC–PIN 25.5.1.1, prepared by U.S. Department of Energy, Grand Junction Office, Grand Junction, Colorado, December.
- DOE (U.S. Department of Energy), 2001. *Remedial Action Plan for the Pinellas 4.5 Acre Site*, U.S. Department of Energy, Grand Junction Office, Grand Junction, Colorado, July.
- DOE (U.S. Department of Energy), 2003a. *Historical Review and Evaluation of Contaminants of Potential Concern*, GJO-2002-359-TAC, February.
- DOE (U.S. Department of Energy), 2003b. *Pinellas Environmental Restoration Project Interim Remedial Action Plan for Ground Water Recovery at the 4.5 Acre Site*, GJO-2003-480-TAC, prepared by U.S. Department of Energy, Grand Junction Office, Grand Junction, Colorado, August.
- DOE (U.S. Department of Energy), 2005. *Pinellas Environmental Restoration Project 4.5 Acre Site Remedial Action Plan Addendum*, DOE-LM/GJ858-2005, prepared by the U.S. Department of Energy Office of Legacy Management, Grand Junction, Colorado, April.
- DOE (U.S. Department of Energy), 2006. *Pinellas Environmental Restoration Project Sampling Procedures for the Young Rainey STAR Center and 4.5 Acre Site*, DOE-LM/GJ1159-2006, prepared by U.S. Department of Energy Office of Legacy Management, Grand Junction, Colorado, April.
- DOE (U.S. Department of Energy), 2007. *4.5 Acre Site Source Characterization Data Report*, DOE-LM/1549-2007, prepared by U.S. Department of Energy Office of Legacy Management, Grand Junction, Colorado, December.
- DOE (U.S. Department of Energy), 2008. 4.5 Acre Site Source Removal Feasibility Study, DOE-LM/1549-2008, prepared by U.S. Department of Energy Office of Legacy Management, Grand Junction, Colorado, April.
- FDEP (Florida Department of Environmental Protection), 2005. Letter from John Armstrong (FDEP) to David Ingle, dated July 7, 2005.

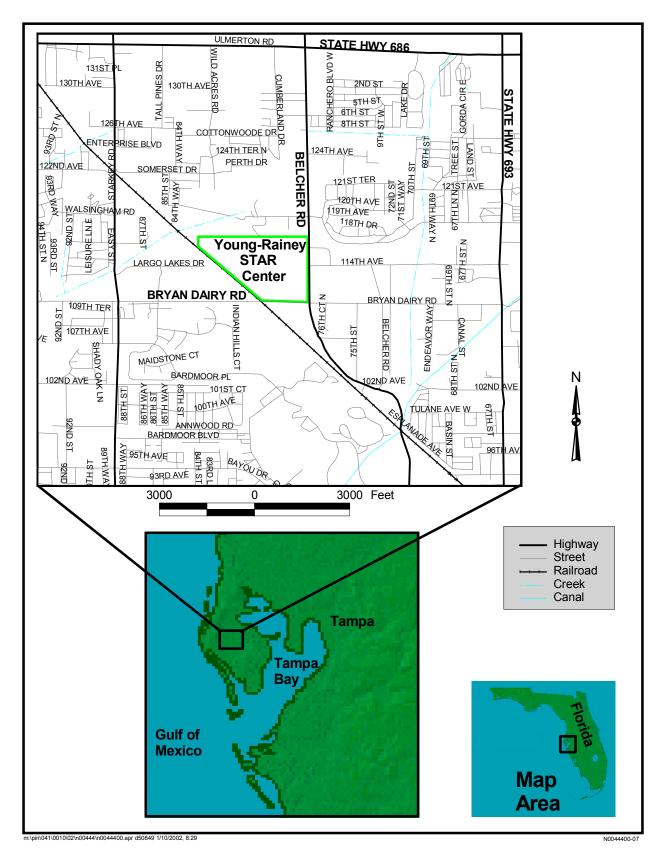


Figure 1. Young - Rainey STAR Center Location

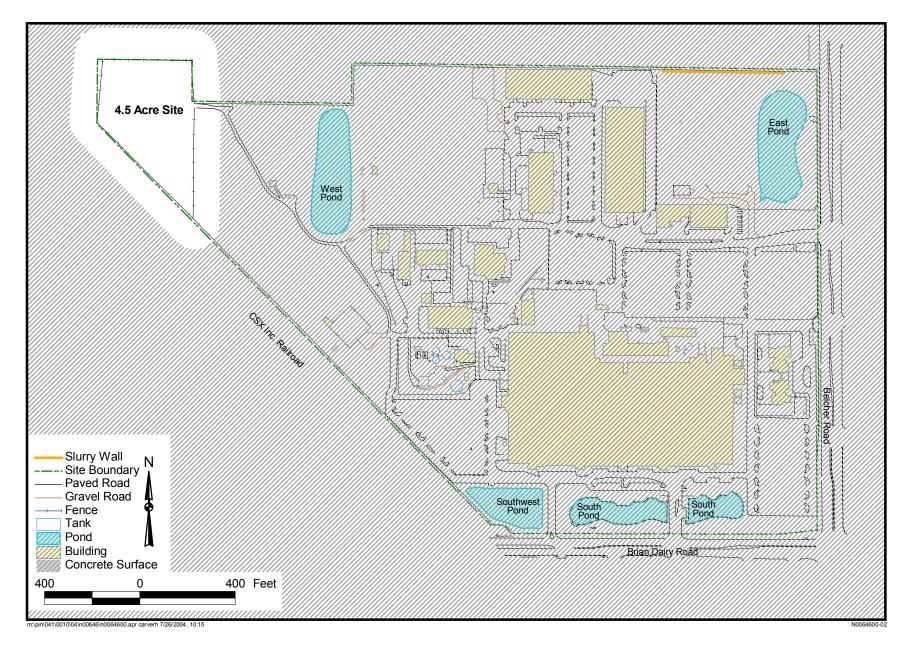


Figure 2. 4.5 Acre Site Location

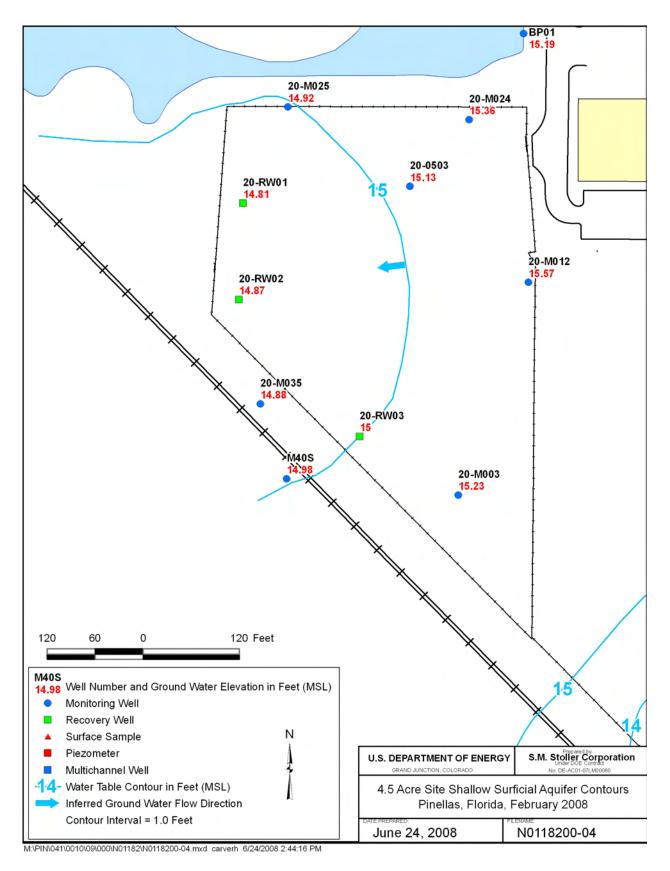


Figure 3. Groundwater Elevations and Shallow Surficial Aquifer Flow, 4.5 Acre Site, February 2008

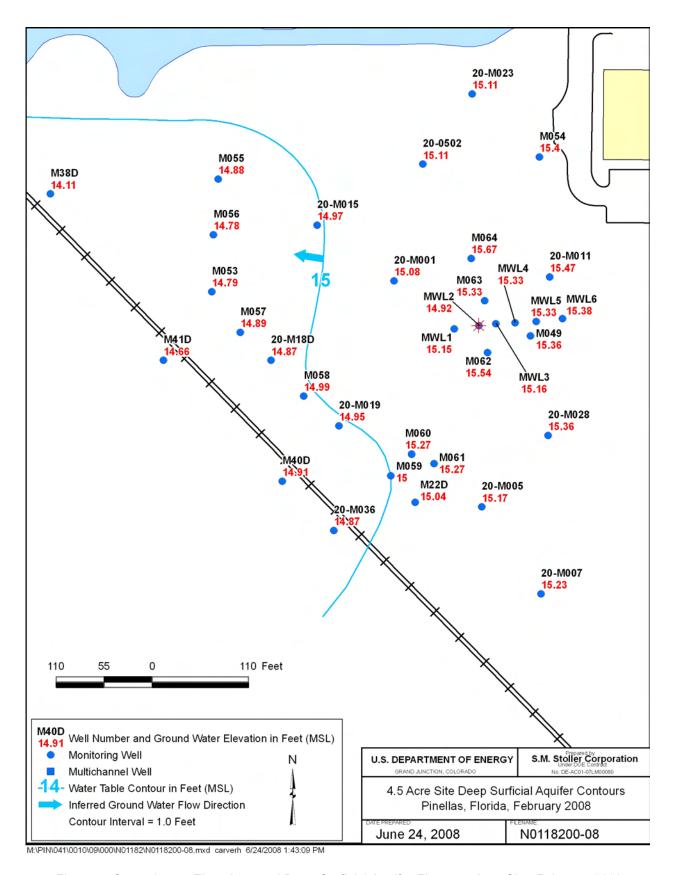


Figure 4. Groundwater Elevations and Deep Surficial Aquifer Flow, 4.5 Acre Site, February 2008

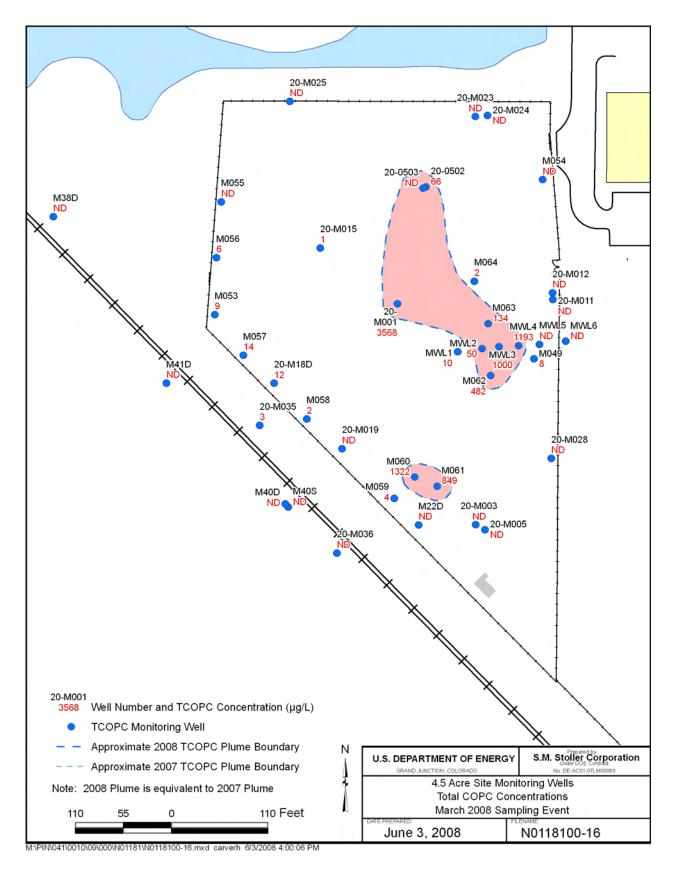


Figure 5. 4.5 Acre Site TCOPC Concentrations March 2008 Sampling Event

# cDCE and VC in PIN20-0502

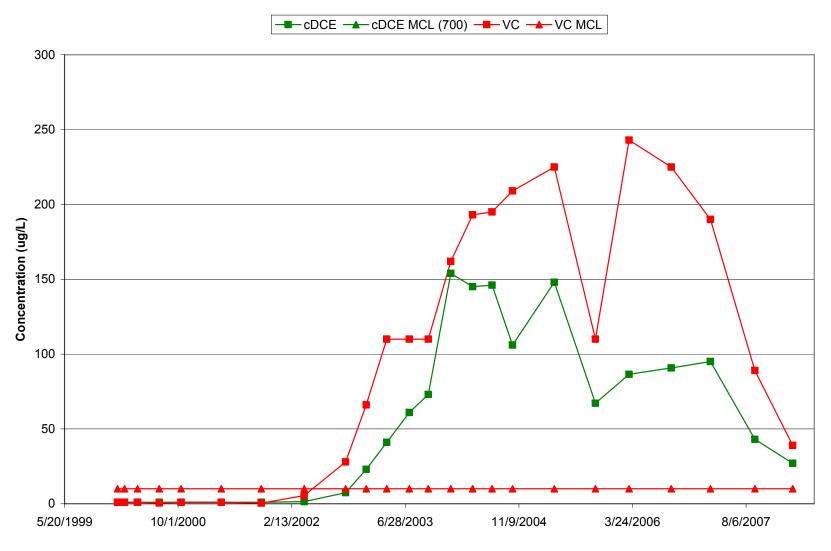


Figure 6. cDCE and VC in PIN20-0502

### cDCE and VC in PIN20-M001

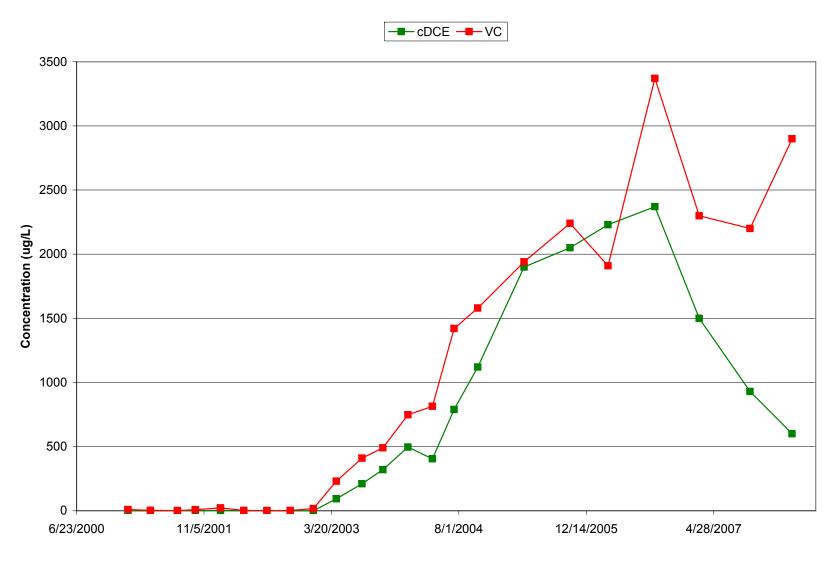


Figure 7. cDCE and VC in PIN20-M001

# 4.5 Acre Site Semiannual Progress Report for December 2007 through May 2008 Doc. No. N0118000 Page 14

### TCE, cDCE, and VC in PIN20-MWL4

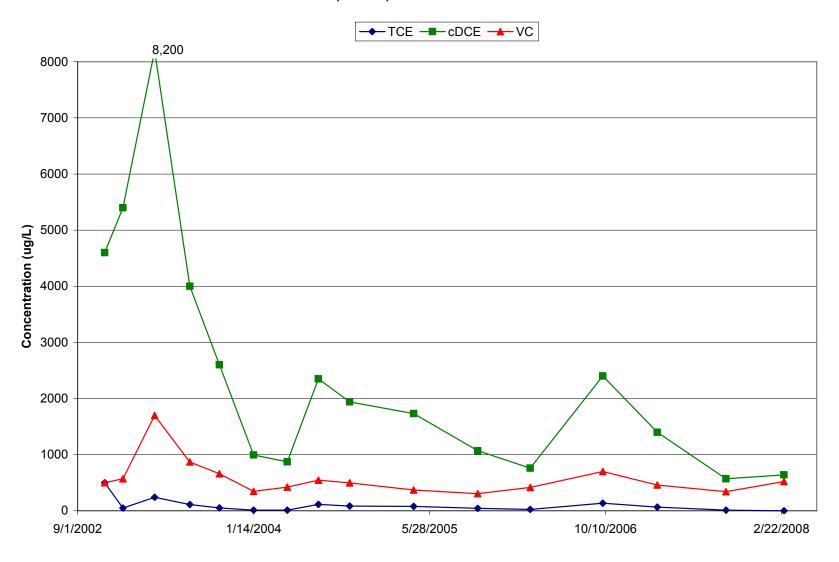


Figure 8. TCE, cDCE, and VC in PIN20-MWL4

### TCE, cDCE, and VC in PIN20-M063

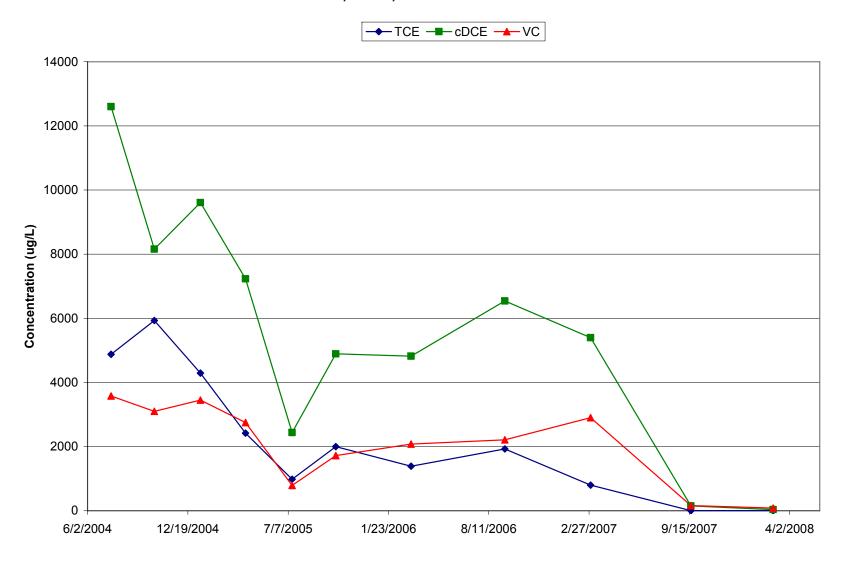


Figure 9. TCE, cDCE, and VC in PIN20-M063

### TCE, cDCE, and VC in PIN20-M060

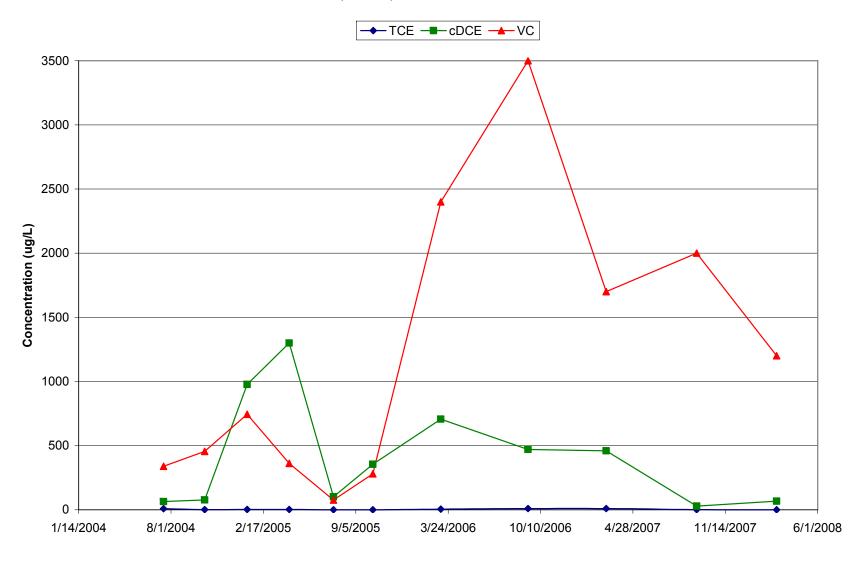


Figure 10. TCE, cDCE, and VC in PIN20-M060

### TCE, cDCE, and VC in PIN20-M061

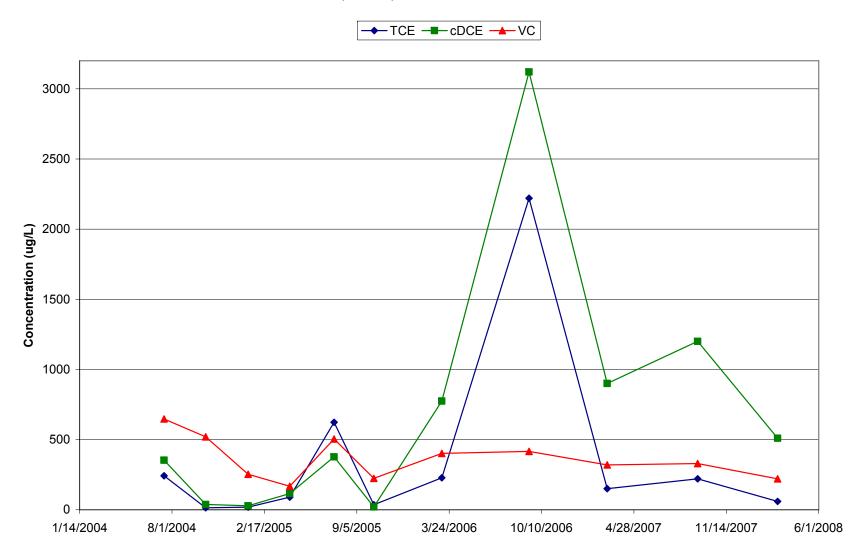


Figure 11. TCE, cDCE, and VC in PIN20-M061

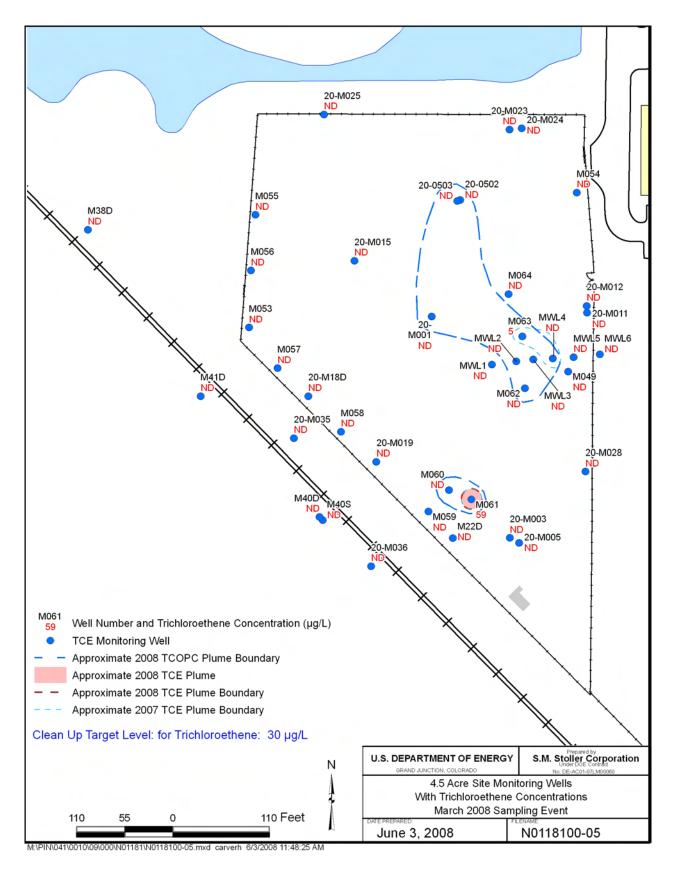


Figure 12. 4.5 Acre Site Trichloroethene Concentrations March 2008 Sampling Event

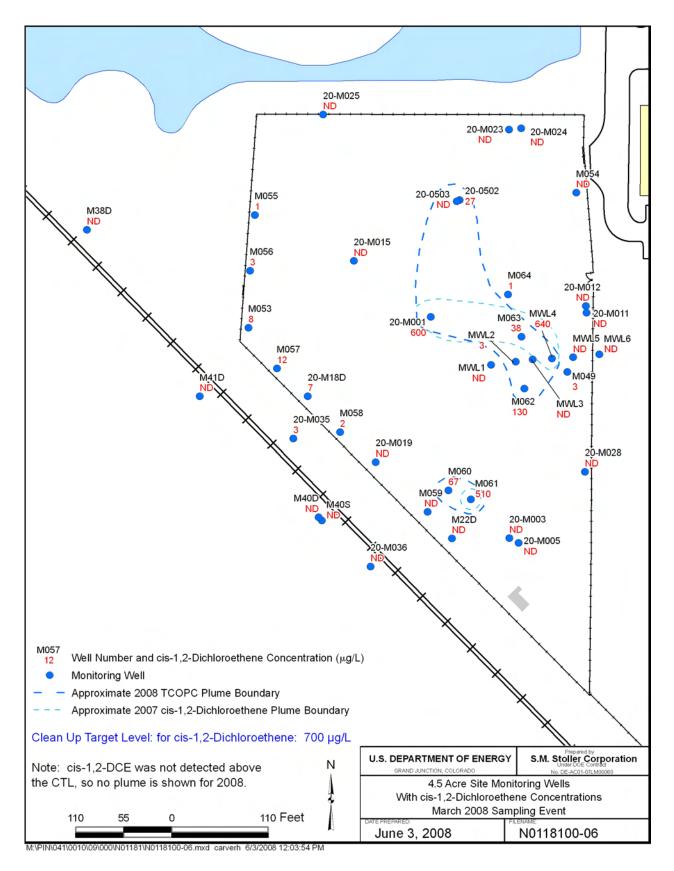


Figure 13. 4.5 Acre Site cis-1,2-Dichloroethene Concentrations March 2008 Sampling Event

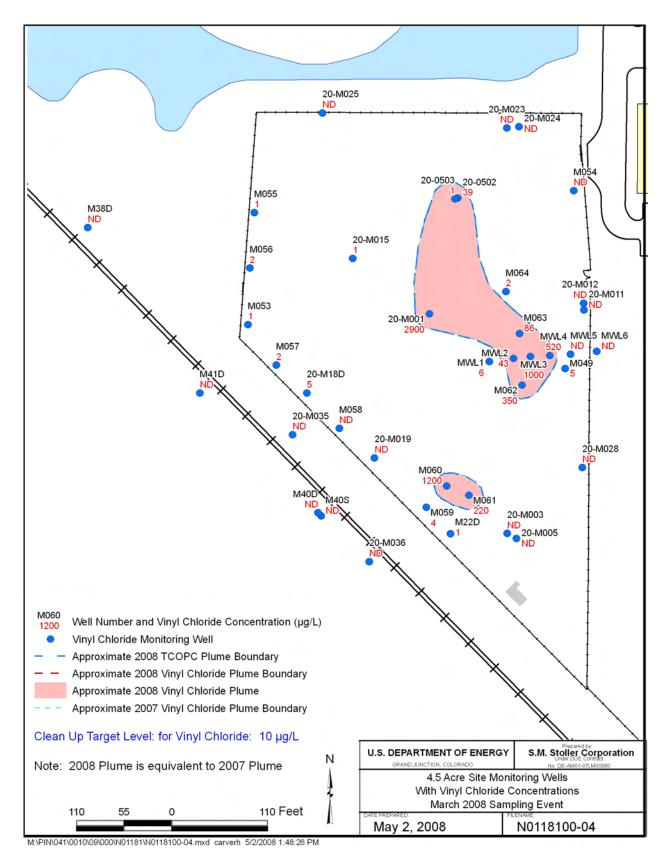


Figure 14. 4.5 Acre Site Vinyl Chloride Concentrations March 2008 Sampling Event

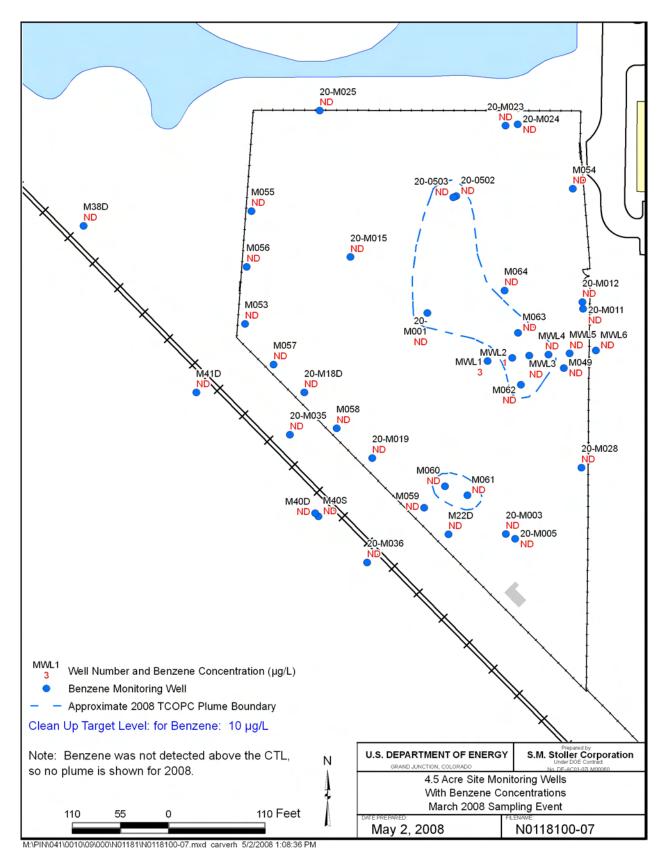


Figure 15. 4.5 Acre Site Benzene Concentrations March 2008 Sampling Event

Table 1. Water-Level Data at the 4.5 Acre Site

Location	Measure	ment	Water Depth From	Ground Water
Location	Date	Time	Land Surface (ft)	Elevation (ft NGVD)
PIN20			4.5 Acre Site	
0502	2/26/2008	08:40	2.29	15.11
0503	2/26/2008	08:41	2.27	15.13
M001	2/26/2008	09:14	2.52	15.08
M003	2/26/2008	09:23	2.97	15.23
M005	2/26/2008	09:24	3.13	15.17
M007	2/26/2008	08:00	4.22	15.23
M011	2/26/2008	08:35	2.63	15.47
M012	2/26/2008	08:35	2.43	15.57
M015	2/26/2008	08:44	2.53	14.97
M019	2/26/2008	09:19	3.05	14.95
M023	2/26/2008	08:38	4.36	15.11
M024	2/26/2008	08:37	2.44	15.36
M025	2/26/2008	08:42	1.38	14.92
M028	2/26/2008	08:04	2.84	15.36
M035	2/26/2008	09:09	3.92	14.88
M036	2/26/2008	09:07	4.43	14.87
M049	2/26/2008	08:32	2.44	15.36
M053	2/26/2008	09:12	2.41	14.79
M054	2/26/2008	08:36	2.30	15.40
M055	2/26/2008	08:48	2.52	14.88
M056	2/26/2008	09:11	2.32	14.78
M057	2/26/2008	09:16	3.01	14.89
M058	2/26/2008	09:18	2.71	14.99
M059	2/26/2008	09:20	2.80	15.00
M060	2/26/2008	10:13	2.06	15.27
M061	2/26/2008	10:11	2.01	15.27
M062	2/26/2008	08:06	2.29	15.54
M063	2/26/2008	08:14	2.77	15.33
M064	2/26/2008	08:34	2.04	15.67
M18D	2/26/2008	09:17	2.83	14.87
M22D	2/26/2008	09:21	2.76	15.04
M38D	2/26/2008	09:00	4.39	14.11
M40D	2/26/2008	09:05	4.49	14.91
M40S	2/26/2008	09:05	4.22	14.98
M41D	2/26/2008	09:03	4.44	14.66
MWL1	2/26/2008	08:11	3.09	15.15
MWL2	2/26/2008	08:13	2.85	14.92
MWL3	2/26/2008	08:20	2.54	15.16
MWL4	2/26/2008	08:25	2.41	15.33
MWL5	2/26/2008	08:29	3.24	15.33
MWL6	2/26/2008	10:01	3.07	15.38
RW01	2/26/2008	08:46	2.79	14.81
RW02	2/26/2008	09:13	2.23	14.87
RW03	2/26/2008	09:19	2.60	15.00

Table 2. 4.5 Acre Site Surface Water Elevations

Location	Measurement		Water Depth From	Ground Water
Location	Date	Time	Land Surface (ft)	Elevation (ft NGVD)
PIN01			Pond 5	
P501	2/26/2008 10:52			13.66
P502	2/26/2008	10:45		13.77
PIN02			West Pond	
W005	2/26/2008 10:34			13.76
PIN20			4.5 Acre Site	
BP01	2/26/2008	09:52		15.19

Table 3. Field Measurements of Samples Collected at the 4.5 Acre Site

Location	Screen Depth (ft bls)	Temperature (°C)	Specific Conductance (µmhos/cm) <sup>a</sup>	Turbidity (NTU)	рН	Oxidation Reduction Potential (mV)	Dissolved Oxygen (mg/L)
PIN20			4.5 Acre	Site	I		
0502	21.2–31.2	23.46	1,426	9.56	6.89	-66.2	0.29
0503	13.2–23.2	23.71	1,657	16.8	6.67	-51.5	0.23
M001	20–25	23.44	1,556	15	6.66	-110	0.28
M003	9–14	22.67	1,004	5.4	6.72	-44.6	1.07
M005	25.8–30.7	23.96	888	5	6.92	-86.2	0.3
M011	23.7–28.7	23.5	916	9.3	6.83	-62.7	3.15
M012	8.6–13.6	21.7	799	10.3	6.9	1.5	4.09
M015	20.8–25.8	22.78	1,108	3.5	6.8	-33	0.66
M019	22–27	23.46	2,019	13	6.77	-81.7	0.7
M023	19.8–24.8	23.44	1,039	13.9	6.89	-93.1	0.22
M024	8.7–13.7	21.82	848	8.78	6.95	-17	0.92
M025	8.6–13.6	19.95	2,071	14.7	6.67	-77.2	0.22
M028	22–27	23.8	901	3	6.85	-49.4	2.85
M035	9–14	22.04	2,436	8.5	6.85	-109	0.37
M036	25–30	23.91	827	11	6.89	-108	0.28
M049	20–30	23.69	1,009	130	6.8	-105	0.36
M053	20–30	23.59	1,470	22	6.87	-80	0.51
M054	20–30	2.87	1,242	40.9	6.84	-136.7	0.31
M055	21–31	23.58	1,200	11.8	6.95	-57.7	0.44
M056	19–29	23.08	1,475	9.22	6.81	-88.8	0.32
M057	20–30	23.35	1,770	7.2	6.83	-95	0.45
M058	18–28	22.93	2,060	95	6.83	-113	0.39
M059	19–29	22.87	1,216	12	6.88	-96.9	0.33
M060	18–28	23.69	853	26	6.91	-130.4	0.41
M061	20–30	23.81	1,329	12	6.84	-128.5	0.36
M062	20–30	21.69	1,974	60	6.43	-87	0.41
M063	19.5–29.5	23.5	2,363	40	6.27	-98	0.28
M064	15–25	21.2	2,624	130	6.39	-86	0.39
M18D	20–30	22.38	1,900	6.7	6.86	-110	0.37
M22D	20–30	23.95	1,264	12	6.88	-96.3	0.24
M38D	20–30	21.26	783	6.2	7.19	-46	0.75
M40D	18–28	23.46	1,393	8.6	6.9	-75	0.36
M40S	4–14	21.94	293	6.6	6.28	48	1.78
M41D	16–26	22.08	1,791	21	6.87	-115	0.37
MWL1	21–26	23.96	2,289	11	6.17	-123.2	0.32
MWL2	21–26	23.49	2,376	14	6.45	-98	0.32
MWL3	21–26	23.27	1,754	4.5	6.42	-101	0.3
MWL4	20.8–25.8	22.87	865	5	6.8	-100	0.27
MWL5	20.8–25.8	23.05	671	7.9	6.78	-93	0.28
MWL6	21.5–26.5	23.31	933	6.4	6.78	-111	0.64

<sup>a</sup>Temperature corrected to 25°C

Table 4. COPC Concentrations from Wells at the 4.5 Acre Site<sup>a</sup> (reported in micrograms per liter)

Location	Screen Depth (ft)	Date Sampled	TCE	cDCE	tDCE	Total 1,2-	Vinyl chloride	Benzene	Total COPC <sup>c</sup>
FDEP MCL		_	3	70	100	63	1	1	
PIN20					4.5 Acre	Site	•		
		03/02/07	<0.5	95	1.5	96.5	190	<0.5	286.5
0502	21.2–31.2	09/14/07	<0.5	43	<0.44	43	89	<0.5	132
0002	•	02/27/08	<0.5	27	<0.44	27	39	<0.5	66
		03/02/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
0503	13.2–23.2	09/14/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
		02/27/08	<0.5	<0.65	<0.44	ND	0.79J	<0.5	ND
		03/02/07	<2.5	1,500	160	1,660	2,300	<2.5	3,960
M001	20–25	09/17/07	<2.5	930	90	1,020	2,200	<2.5	3,220
		02/29/08	<12	600	68	668	2,900	<12	3,568
		03/01/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
M003	9–14	09/12/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
		03/04/08	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
		03/01/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
M005	25.8–30.7	09/12/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
		03/04/08	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
M007	25.3–30.3	03/01/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
IVIOO7		09/13/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
	23.7–28.7	03/02/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
M011		09/17/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
		03/03/08	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
		03/02/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
M012	8.6–13.6	09/17/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
		03/03/08	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
		03/06/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
M015	20.8–25.8	09/17/07	<0.5	<0.65	<0.44	ND	2.1	<0.5	2.1
		02/29/08	<0.5	<0.65	<0.44	ND	1.4	<0.5	1.4
		03/01/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
M019	22–27	09/12/07	<0.5	<0.65	<0.44	ND	0.81J	<0.5	ND
		03/03/08	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
		03/02/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
M023	19.8–24.8	09/14/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
		02/27/08	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
		03/02/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
M024	8.7–13.7	09/14/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
		02/27/08	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
		03/02/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
M025	8.6–13.6	09/17/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
20		02/27/08	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
		03/02/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
M028	22–27	09/13/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
		03/03/08	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND

Table 4 (continued). COPC Concentrations from Wells at the 4.5 Acre Site (reported in micrograms per liter)

Location	Screen Depth (ft)	Date Sampled	TCE	cDCE	tDCE	Total 1,2- DCE <sup>b</sup>	Vinyl chloride	Benzene	Total COPC <sup>c</sup>
FDEP MCL			3	70	100	63	1	1	
M035		03/07/07	<0.5	2.4	0.45J	2.4	<0.5	<0.5	2.4
	9–14	09/14/07	<0.5	3.4	<0.44	3.4	<0.5	<0.5	3.4
		02/28/08	<0.5	2.8	0.52J	2.8	<0.5	<0.5	2.8
		03/07/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
M036	25–30	09/14/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
		02/28/08	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
		03/02/07	<0.5	5.1	<0.44	5.1	4.6	<0.5	9.7
M049	20–30	09/13/07	<0.5	3.7	<0.44	3.7	2.3	<0.5	6
		02/29/08	<0.5	2.8	0.59J	2.8	4.7	<0.5	7.5
		03/01/07	<0.5	8.3	<0.44	8.3	1.5	<0.5	9.8
M053	20–30	09/12/07	<0.5	11	<0.44	11	3.4	<0.5	14.4
		02/28/08	<0.5	7.7	<0.44	7.7	1.4	<0.5	9.1
		03/02/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
M054	20–30	09/14/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
		02/27/08	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
		03/02/07	<0.5	2.6	<0.44	2.6	4	<0.5	6.6
M055	21–31	09/17/07	<0.5	<0.65	<0.44	ND	3.2	<0.5	3.2
		02/27/08	<0.5	0.66J	<0.44	0.66J	0.68J	<0.5	ND
	19–29	03/02/07	<0.5	4.1	<0.44	4.1	3.9	<0.5	8
M056		09/12/07	<0.5	4	<0.44	4	7.3	<0.5	11.3
		02/27/08	<0.5	3.1	<0.44	3.1	2.5	<0.5	5.6
		03/01/07	<0.5	19	<0.44	19	3.2	<0.5	22.2
M057	20–30	09/12/07	<0.5	18	<0.44	18	5.3	<0.5	23.3
		02/28/08	<0.5	12	<0.44	12	1.8	<0.5	13.8
		03/01/07	<0.5	1.6	<0.44	1.6	1.7	<0.5	3.3
M058	18–28	09/12/07	<0.5	<0.65	<0.44	ND	3.3	<0.5	3.3
		03/03/08	<0.5	1.6	0.46J	1.6	<0.5	<0.5	1.6
	19–29	03/01/07	<0.5	<0.65	<0.44	ND	4.1	<0.5	4.1
M059		09/12/07	<0.5	<0.65	<0.44	ND	9.5	<0.5	9.5
		03/03/08	<0.5	<0.65	<0.44	ND	4.1	<0.5	4.1
		03/01/07	9.9	460	100	560	1,700	<2.5	2,269.9
M060	18–28	09/13/07	<1	28	20	48	2,000	<1	2,048
		03/04/08	<10	67	55	122	1,200	<10	1,322
		03/01/07	150	900	69	969	320	<1	1,439
M061	20–30	09/13/07	220	1,200	68	1,268	330	<2.5	1,818
		03/04/08	59	510	60	570	220	<0.5	849
		03/01/07	4.8	300	5	305	600	1.5	911.3
M062	20–30	09/17/07	<0.5	160	3.1	163.1	830	<0.5	993.1
		02/29/08	<0.5	130	1.5	131.5	350	<0.5	481.5
		03/02/07	800	5,400	320	5,720	2,900	<5	9,420
M063	19.5–29.5	09/18/07	7	150	19	169	160	<0.5	336
		02/29/08	5.3	38	5.1	43.1	86	<1	134.4
		03/06/07	<0.5	<0.65	<0.44	ND	1.1	<0.5	1.1
M064	15–25	09/17/07	<0.5	<0.65	<0.44	ND	2.7	<0.5	2.7
		02/29/08	<0.5	0.98J	<0.44	0.98J	2.3	<0.5	2.3

Table 4 (continued). COPC Concentrations from Wells at the 4.5 Acre Site (reported in micrograms per liter)

Location	Screen Depth (ft)	Date Sampled	TCE	cDCE	tDCE	Total 1,2- DCE <sup>b</sup>	Vinyl chloride	Benzene	Total COPC <sup>c</sup>
FDEP MCL			3	70	100	63	1	1	
		03/01/07	<0.5	15	<0.44	15	4.6	<0.5	19.6
M18D	20–30	09/12/07	<0.5	13	0.74J	13	10	<0.5	23
		02/28/08	<0.5	7.4	0.59J	7.4	5.1	<0.5	12.5
		03/01/07	<0.5	<0.65	<0.44	ND	1.1	<0.5	1.1
M22D	20–30	09/13/07	<0.5	<0.65	<0.44	ND	1.4	<0.5	1.4
		03/03/08	<0.5	<0.65	<0.44	ND	0.71J	<0.5	ND
		03/07/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
M38D	20–30	09/14/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
		02/28/08	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
		03/07/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
M40D	18–28	09/14/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
	•	02/28/08	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
		03/07/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
M40S	4–14	09/14/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
	-	02/28/08	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
	16–26	03/07/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
M41D		09/14/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
		02/28/08	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
	21–26	03/06/07	<0.5	<0.65	<0.44	ND	5.5	2.5	8
MWL1		09/14/07	<0.5	<0.65	<0.44	ND	4	1.9	5.9
		03/01/08	<0.5	<0.65	<0.44	ND	6.5	3.3	9.8
	21–26	03/06/07	<0.5	1.3	2.9	4.2	16	<0.5	20.2
MWL2		09/14/07	<0.5	<0.65	2.7	2.7	19	<0.5	21.7
		02/29/08	<0.5	2.6	4.8	7.4	43	0.56J	50.4
		03/06/07	<0.5	71	6.5	77.5	1,500	<0.5	1,577.5
MWL3	21–26	09/14/07	<0.5	26	6.5	32.5	1,400	<0.5	1,432.5
		02/29/08	<5	<6.5	5.2J	5.2J	1,000	<5	1,000
		03/06/07	64	1,400	66	1,466	460	<0.5	1,990
MWL4	20.8–25.8	09/17/07	10	570	35	605	340	<0.5	955
		02/29/08	<5	640	33	673	520	<5	1,193
		03/06/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
MWL5	20.8–25.8	09/13/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
1414420		02/29/08	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
		03/06/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
MWL6	21.5–26.5	09/17/07	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND
		03/04/08	<0.5	<0.65	<0.44	ND	<0.5	<0.5	ND

<sup>&</sup>lt;sup>a</sup>"<" values are reporting limits.

<sup>&</sup>lt;sup>b</sup>Total 1,2–DCE is the sum of cDCE and tDCE.

<sup>&</sup>lt;sup>c</sup>Total COPC is the sum of the individual COPC concentrations. The cDCE and tDCE values are not part of the total COPC value because these values are included in the total 1,2–DCE value. "J" values are not included in the total COPC value.

ND = Not detected

J = Estimated value, result is between the reporting limit and the method detection limit. Arsenic, while a COPC, is not included in this table, nor in the TCOPC value.

Table 5. RPD for Duplicate Samples, 4.5 Acre Site

Sample	Analyte	Result	Dup Result	RPD	MDL	5xMDL	Fail?
PIN20-0502	cis-1,2-Dichloroethylene	27	25	8	0.65	3.25	
	Vinyl chloride	39	37	5	0.5	2.5	
PIN20-M001	cis-1,2-Dichloroethylene	600	580	3	13	65	
	trans-1,2-Dichloroethylene	68	95	33	0.44	2.2	Yes
	Vinyl chloride	2900	1700	52	10	50	Yes